

From: FNAL::WAKE "MAS-A-YOSHI WAKE" 29-MAR-1991 12:58:35.30
 To: PEWITT, JBS
 CC:
 Subj: DC306 Furukawa Cable

I had a communication with Furukawa regarding the oversize of the cable. They measured the cable by the size of ten stack. Inspection report of them says:

	designed	measured	over size
SG-90136-2	57.40 mil	57.76 mil	0.36 mil
SG-90136-3	57.40 mil	57.81 mil	0.41 mil

This oversize account for the 7 mil oversize of the cured coil. Therefore the inspection method was right. There seems to be a long story why this cable was shipped. They had a order of 0.574+-0.005 cable in the past and specification for this time was 0.574+-0.0025, everything the same except the tolerance. That was the cause of confusion for them.

They are very much embarrassed with this mistake and asking us what to do with this cable. What should we say?

cc: S. Delchamps
 W. Koska
 D. Sims